



# Sun Fire™ Midrange Systems Firmware 5.18.0 Release Notes

---

Sun Microsystems, Inc.  
[www.sun.com](http://www.sun.com)

Part No. 817-7813-10  
October 2004, Revision A

Submit comments about this document at: <http://www.sun.com/hwdocs/feedback>

Copyright 2004 Sun Microsystems, Inc., 4150 Network Circle, Santa Clara, California 95054, U.S.A. All rights reserved.

Sun Microsystems, Inc. has intellectual property rights relating to technology embodied in the product that is described in this document. In particular, and without limitation, these intellectual property rights may include one or more of the U.S. patents listed at <http://www.sun.com/patents> and one or more additional patents or pending patent applications in the U.S. and in other countries.

---

This document and the product to which it pertains are distributed under licenses restricting their use, copying, distribution, and decompilation. No part of the product or of this document may be reproduced in any form by any means without prior written authorization of Sun and its licensors, if any.

Third-party software, including font technology, is copyrighted and licensed from Sun suppliers.

Parts of the product may be derived from Berkeley BSD systems, licensed from the University of California. UNIX is a registered trademark in the U.S. and in other countries, exclusively licensed through X/Open Company, Ltd.

Sun, Sun Microsystems, the Sun logo, docs.sun.com, Java, OpenBoot, Sun Fire, SunStorEdge, and Solaris, are trademarks or registered trademarks of Sun Microsystems, Inc. in the U.S. and in other countries.

All SPARC trademarks are used under license and are trademarks or registered trademarks of SPARC International, Inc. in the U.S. and in other countries. Products bearing SPARC trademarks are based upon an architecture developed by Sun Microsystems, Inc.

The OPEN LOOK and Sun™ Graphical User Interface was developed by Sun Microsystems, Inc. for its users and licensees. Sun acknowledges the pioneering efforts of Xerox in researching and developing the concept of visual or graphical user interfaces for the computer industry. Sun holds a non-exclusive license from Xerox to the Xerox Graphical User Interface, which license also covers Sun's licensees who implement OPEN LOOK GUIs and otherwise comply with Sun's written license agreements.

U.S. Government Rights—Commercial use. Government users are subject to the Sun Microsystems, Inc. standard license agreement and applicable provisions of the FAR and its supplements.

DOCUMENTATION IS PROVIDED "AS IS" AND ALL EXPRESS OR IMPLIED CONDITIONS, REPRESENTATIONS AND WARRANTIES, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE OR NON-INFRINGEMENT, ARE DISCLAIMED, EXCEPT TO THE EXTENT THAT SUCH DISCLAIMERS ARE HELD TO BE LEGALLY INVALID.

---

Copyright 2004 Sun Microsystems, Inc., 4150 Network Circle, Santa Clara, California 95054, Etats-Unis. Tous droits réservés.

Sun Microsystems, Inc. a les droits de propriété intellectuelle relatifs à la technologie incorporée dans le produit qui est décrit dans ce document. En particulier, et sans la limitation, ces droits de propriété intellectuelle peuvent inclure un ou plus des brevets américains énumérés à <http://www.sun.com/patents> et un ou les brevets plus supplémentaires ou les applications de brevet en attente dans les Etats-Unis et dans les autres pays.

Ce produit ou document est protégé par un copyright et distribué avec des licences qui en restreignent l'utilisation, la copie, la distribution, et la décompilation. Aucune partie de ce produit ou document ne peut être reproduite sous aucune forme, par quelque moyen que ce soit, sans l'autorisation préalable et écrite de Sun et de ses bailleurs de licence, s'il y en a.

Le logiciel détenu par des tiers, et qui comprend la technologie relative aux polices de caractères, est protégé par un copyright et licencié par des fournisseurs de Sun.

Des parties de ce produit pourront être dérivées des systèmes Berkeley BSD licenciés par l'Université de Californie. UNIX est une marque déposée aux Etats-Unis et dans d'autres pays et licenciée exclusivement par X/Open Company, Ltd.

Sun, Sun Microsystems, le logo Sun, docs.sun.com, Java, OpenBoot, Sun Fire, SunStorEdge, et Solaris sont des marques de fabrique ou des marques déposées de Sun Microsystems, Inc. aux Etats-Unis et dans d'autres pays.

Toutes les marques SPARC sont utilisées sous licence et sont des marques de fabrique ou des marques déposées de SPARC International, Inc. aux Etats-Unis et dans d'autres pays. Les produits portant les marques SPARC sont basés sur une architecture développée par Sun Microsystems, Inc.

L'interface d'utilisation graphique OPEN LOOK et Sun™ a été développée par Sun Microsystems, Inc. pour ses utilisateurs et licenciés. Sun reconnaît les efforts de pionniers de Xerox pour la recherche et le développement du concept des interfaces d'utilisation visuelle ou graphique pour l'industrie de l'informatique. Sun détient une licence non exclusive de Xerox sur l'interface d'utilisation graphique Xerox, cette licence couvrant également les licenciés de Sun qui mettent en place l'interface d'utilisation graphique OPEN LOOK et qui en outre se conforment aux licences écrites de Sun.



# Contents

---

Firmware Documentation for Sun Fire Midrange and Entry-Level Midrange Systems	1
New Features	2
DHCP Network Boot Changes	2
General Information	3
Firmware Compatibility	3
Firmware Upgrade and Downgrade	4
Power Supply Failures	4
Known Limitations for Sun Fire Midrange Systems	5
SC Hangs After Automatic <code>setkeyswitch off</code> (RFE 4454599)	5
SNMP: FrameManager Does Not Have an Entry in the MIB and Frame State Traps (RFE 4987286)	6
<code>sgcn_output_line()</code> : OBP console blocked; message data lost (BugID 4939206)	6
SC is “hard hung” Doing a <code>dumpconfig</code> to Host With TCP Wrappers (BugID 5028357)	6
Upgrade of Firmware Changes Connection Type (BugID 5060748)	6
Board State Becomes Incorrect After <code>setkeyswitch</code> or <code>testboard</code> Operations (BugID 5066326)	7
<code>disablecomponent</code> Fails to Blacklist an I/O Card (BugID 5074564)	7
Wanboot “panic - boot: create_ramdisk: fatal error” on Sun Fire Midrange Server Platforms (BugID 5076076)	8

ERROR: DomainBufferReader thread error java.lang.  
NullPointerException (BugID 5088923) 8

Power Failure May Corrupt SEEPROM Contents (BugID 5093450) 9

Removing an SC, Even Though it Has Been Powered Off, Can Cause a Domain  
Outage (BugID 5105071) 9

# Sun Fire™ Midrange Systems Firmware 5.18.0 Release Notes

---

This document provides general information and system limitations for firmware release 5.18.0 on Sun Fire E6900/E4900/6800/4810/4800/3800 systems.

This document contains the following topics:

- [Firmware Documentation for Sun Fire Midrange and Entry-Level Midrange Systems](#)
  - [New Features](#)
  - [General Information](#)
  - [Known Limitations for Sun Fire Midrange Systems](#)
- 

## Firmware Documentation for Sun Fire Midrange and Entry-Level Midrange Systems

The following documentation sets are included with the 5.18.0 firmware:

- Sun Fire midrange (E6900/E4900/6800/4810/4800/3800) systems
  - *Sun Fire Midrange Systems Platform Administration Manual* (part number 817-7814-10)
  - *Sun Fire Midrange System Controller Command Reference Manual* (part number 817-7815-10)
  - *Sun Fire Midrange Systems Firmware 5.18.0 Release Notes* (part number 817-7813-10)
  - `Install.info` – A text file included with the firmware that describes the firmware upgrade and downgrade procedures for Sun Fire midrange systems.

For firmware upgrade and downgrade information on entry-level midrange (E2900/V1280/Netra 1280) systems, refer to the *Sun Fire Entry-Level Midrange System Administration Guide*.

- Sun Fire entry-level midrange (E2900/V1280/Netra 1280) systems
  - *Sun Fire Entry-Level Midrange System Administration Guide* (part number 817-7812-10)
  - *Sun Fire Entry-Level Midrange System Controller Command Reference Manual* (part number 817-7811-10)
  - *Sun Fire Entry-Level Midrange System Firmware 5.18.0 Release Notes* (part number 817-77810-10)

---

## New Features

### DHCP Network Boot Changes

5.18.0 firmware modifies the behavior of the OpenBoot PROM when booting off of the network using the DHCP protocol.

During the network boot process, clients use TFTP to download an initial boot binary (such as `inetboot`) from a TFTP boot server specified by the DHCP server. If the DHCP server does not tell the client the name of the file to be downloaded, the OpenBoot PROM uses a default file name for the TFTP request. In previous firmware releases the default boot file name was the client's IP address expressed as a string of eight hexadecimal characters (for example, a client whose IP address was 192.168.100.1 would request a file named `C0A86401`). While this behavior is correct for non-DHCP network boots, it is incorrect for network booting with DHCP.

Starting in this release, the default boot file name used by the OpenBoot PROM is constructed from the client's platform type. Unless the DHCP server specifies a different boot file name, midrange platforms request a file named `SUNW.Sun-Fire` while entry-level midrange platforms request a file named `SUNW.Netra-T12`. This behavior is consistent with the net boot server setup tools distributed with Solaris software.

With this change, you might (depending upon your network boot configurations) see net boot errors after installing the new firmware. Specifically, if the requested boot file does not exist on the TFTP boot server, the OpenBoot PROM issues the following message and fails to boot the Solaris Operating System:

```
ERROR: get_tftp_file: TFTP error 2: Access violation
```

**Workarounds:** This situation can be corrected in several ways, including (but not limited to):

- Rename the boot file on the TFTP boot server (such as from C0A86401 to SUNW.Sun-Fire)
- Create a symbolic link on the TFTP boot server which points to the actual file (for example, # `ln -s C0A86401 SUNW.Netra-T12`)
- Modify the DHCP macros on the DHCP server to provide an explicit boot file name for clients.

The DHCP network boot process supports configurations in which the DHCP server and the TFTP boot server are different machines. If the DHCP server and other network components are configured correctly, the DHCP and TFTP servers can exist on different IP subnets. However, the OpenBoot PROM firmware in previous releases assumes that the DHCP server and the TFTP server are the same machine even if the DHCP server indicates otherwise.

Starting with this release, the OpenBoot PROM handles configurations correctly in which the DHCP and TFTP servers are not the same machine, including when they are on different subnets. For cross-subnet TFTP configurations, note that the DHCP server must be configured to provide proper Router and Subnet values to the client.

With this change, if your DHCP servers are improperly configured (providing incorrect Router or Subnet values to clients), you might see net boot errors after installing the new firmware. OpenBoot PROM firmware on the client might issue one or both of the following messages in that situation:

```
ERROR: get_arp_info: Timeout waiting for ARP packet
```

```
ERROR: tftp_get_repy: Timeout waiting for TFTP packet
```

**Workaround:** To eliminate these error messages, verify that the Router and Subnet values sent to the client by the DHCP server are correct.

---

## General Information

### Firmware Compatibility

System boards running firmware versions 5.12.x through 5.18.x firmware are compatible with each other, but system boards running 5.11.x are not compatible with system boards running firmware versions 5.12.x through 5.18.x. You can check the firmware compatibility of your boards by running the

`showboards -p version -v` command. The information displayed indicates whether the firmware for each board is compatible with the ScApp version running on the SC.

Update all your system boards to the same firmware version and activate the new firmware version on your domains as soon as possible. Activate the domain firmware by running the `setkeyswitch off` and `setkeyswitch on` commands. For details on updating your system firmware and verifying firmware compatibility, refer to the `Install.info` file included with this firmware release.

UltraSPARC IV CPU/Memory boards require 5.16.0 firmware or greater. The UltraSPARC IV CPU/Memory boards will not run on firmware releases earlier than 5.16.0. COD boards must be running a firmware version that supports COD, which was introduced in firmware release 5.14.0.

## Firmware Upgrade and Downgrade

Instructions for upgrading firmware are provided in the `Install.info` file included with this firmware release for Sun Fire midrange systems. The `Install.info` file also contains instructions for downgrading to an earlier version of the firmware.

E6900/E4900 systems and systems that contain UltraSPARC IV CPU/Memory boards must run firmware version 5.16.0 or greater. Earlier firmware versions do not support the UltraSPARC IV CPU/Memory boards.

Midrange systems with SC V2s can be downgraded from 5.18.0 to earlier firmware releases, but note that those earlier releases will not support bug fixes made in 5.18.0.



---

**Caution** – If you have a redundant system controller (SC) configuration, you must first upgrade the firmware on the spare SC, then on the main SC, as explained in the `Install.info` file.

---

## Power Supply Failures

In some cases powering off or powering on a power supply after you upgrade to firmware version 5.14.x or greater can cause a power supply fault on Sun Fire 6800/4810/4800/3800 systems.

---

**Note** – The faults described here do *not* apply to the A184 and A185 power supplies.

---



The power supply failure might exhibit the following characteristics:

- Only the amber *fault* LED of the power supply is illuminated.
- The showboards command output identifies the Status for the power supply as Failed or the Component Type as No Grid Power.

Use the following workarounds to resolve the power supply failure. Start with Workaround 1. If this workaround is unsuccessful, perform Workaround 2. If the second workaround is unsuccessful, perform Workaround 3.

- Workaround 1 – Turn the power supply switch off and then on. However, if you have a Sun Fire 6800 system, perform Workaround 2 instead, as the power supplies do not have a switch.
- Workaround 2 – Remove the failed power supply from the system, wait 20 seconds, then put it back in. If its green *activated* LED is not the only LED illuminated, repeat the procedure until only the green *activated* LED is illuminated. Several attempts may be necessary.
- Workaround 3 – Reboot the SC, then use the `power on` command to turn on the power supply.

---

## Known Limitations for Sun Fire Midrange Systems

This section describes only those bugs with potentially significant impact. The README file lists all bugs, including those seen only internally at Sun.

### SC Hangs After Automatic `setkeyswitch off` (RFE 4454599)

Manual reset of the SC has no effect.

**Workaround:** Do the following:

1. Connect to each active domain through a network connection, such as `telnet` or `rlogin`.
2. Shut down each domain, if possible.
3. Power down the Sun Fire midrange system, then power it up again.

## SNMP: FrameManager Does Not Have an Entry in the MIB and Frame State Traps (RFE 4987286)

SNMP is a private interface for the midrange system controllers. This means that Sun Management Center will not receive FrameManager information through SNMP. If you have a loghost, note that FrameManager and RTU statuses can be monitored from the loghost.

**Workaround:** None.

## `sgcn_output_line(): OBP console blocked; message data lost (BugID 4939206)`

A message indicating that there are dropped console messages is displayed when data is being provided by the Solaris Operating System or OpenBoot PROM faster than the system controller can write it to the console.

**Workaround:** None

## SC is “hard hung” Doing a `dumpconfig` to Host With TCP Wrappers (BugID 5028357)

The system controller becomes hard hung when `dumpconfig` output is sent to a host that has TCP wrappers and a configuration that denies FTP connections.

**Workaround:** Do not use a host that has TCP wrappers.

## Upgrade of Firmware Changes Connection Type (BugID 5060748)

If you change the connection type after downgrading firmware on midrange systems from 5.17.x or 5.18.x to a lower firmware version, the new connection type selected in the lower firmware version is not guaranteed once you update the firmware back to 5.17.x or 5.18.x. If you subsequently update the firmware to 5.17.x or 5.18.x from the lower firmware version, the original connection type that you had in 5.17.x or 5.18.x before the change to a lower firmware version will be restored.

**Workaround:** To ensure system security, use the `setupplatform` command to set the connection type explicitly.

## Board State Becomes Incorrect After `setkeyswitch` or `testboard` Operations (BugID 5066326)

After a domain panic occurs or when a domain encounters errors, output from a subsequent `setkeyswitch` or `testboard` operation will show that the board processors have an Unknown status. For example:

```
schostrname:A> testb sb4
Sep 24 11:01:53 schostrname-sc0 Domain-A.POST: Domain A: diag-level = init
Sep 24 11:01:53 schostrname-sc0 Domain-A.POST: Domain A: verbosity-level = min
Sep 24 11:01:53 schostrname-sc0 Domain-A.POST: Domain A: error-level = max
{/N0/SB4/P0} Unknown
{/N0/SB4/P1} Unknown
{/N0/SB4/P2} Unknown
{/N0/SB4/P3} Unknown
schostrname:A>
```

**Workaround:** Reboot the system controller.

## `disablecomponent` Fails to Blacklist an I/O Card (BugID 5074564)

If you run the `disablecomponent` or `setlsl` command to blacklist an I/O card, the card is not disabled at the OpenBoot PROM (OBP) level.

**Workaround:** Perform a `setkeyswitch off` and then a `setkeyswitch on` operation after disabling the I/O card.

## Wanboot "panic - boot: create\_ramdisk: fatal error" on Sun Fire Midrange Server Platforms (BugID 5076076)

If you are using a wanboot server to boot a Sun Fire midrange system (E6900, E4900, E2900, 6800, 4810, 4800, 3800 and the V1280), the wanboot server cannot create the ramdisk and is unable to boot the Sun Fire midrange system.

**Workaround:** None.

## ERROR: DomainBufferReader thread error java.lang. NullPointerException (BugID 5088923)

In certain situations, this error message can occur when you run `reset` or `shutdown` commands from the domain console shell. The error does not affect the availability of the domain. However, the `reset` or `shutdown` commands may take an additional 60 seconds to complete.

**Workaround:** None.

## Power Failure May Corrupt SEEPROM Contents (BugID 5093450)

If a power failure and ScApp reboot occur during an add segment operation, one or more SEEPROM segments may become corrupted upon a reboot. The following example log sequence shows illegal tag statements:

```
Aug 04 14:18:42 schostname-SC0 schostname-sc0 Platform.SC: [ID 470632 local0.error]
/N0/SB2: SepromSegment(constructor): ID at 0x0042: Illegal Tag 0x00 at 0x002b
Aug 04 14:18:42 schostname-sc0 schostname-sc0 Platform.SC: [ID 576073 local0.error]
/N0/SB2: SepromSegment(constructor): PE at 0x00bf: Illegal Tag 0x00 at 0x0102
Aug 04 14:18:42 schostname-sc0 schostname-sc0 Platform.SC: [ID 982808 local0.error]
/N0/SB2: SepromSegment(constructor): PS at 0x01c6: Illegal Tag 0x00 at 0x0000
Aug 04 14:18:42 schostname-sc0 schostname-sc0 Platform.SC: [ID 586548 local0.error]
/N0/SB2: SepromSegment(constructor): FD at 0x01dd: Illegal Tag 0x00 at 0x0002
Aug 04 14:18:46 schostname-sc0 Platform.SC: [ID 139087 local0.notice] Clear
/N0/SB2 invalid segment
.
.
.
```

Even though these error messages are displayed, the availability of the domains is not affected.

**Workaround:** None.

## Removing an SC, Even Though it Has Been Powered Off, Can Cause a Domain Outage (BugID 5105071)

If you power off an SC from the other SC and then run the `showboards -p clock` command, the system clock status of the SC (that you powered off) is still displayed. If you then remove the powered-off SC, a domain outage can occur.

**Workaround:** Before removing an SC, do the following:

1. After powering off the SC, run the `showboards -p clock` command to check the system clock status of the powered-off SC.
2. If any board in an active domain is using the system clock of the powered-off SC, as indicated in the `Signal Used` column, *do not* remove the powered-off SC.

